

Cub Crimper Crimping Tool

The Quick Cable System includes everything you need to build or repair your heavy duty electrical circuit




Connectors

- Over 51 different styles straights, elbows, flags etc.
- Positive, negative & universal
- 10 cable sizes from 8 gauge to 250 MCM
- Clamps & lugs, copper & lead
- Color-coded to match cable & crimp tool
- Crimp, compression, & solder connectors



Cable

- Battery & welding cable
- Red & black insulation
- Ten sizes from 8 gauge to 250 MCM
- Color-coded to match connectors & crimp tool



Protective Products

- Heat shrink tube in three grades, nine diameters, red, black & clear
- Terminal protectors, eight styles, all sizes, red or black
- Loom made of nylon 6 high temperature, 409° F rating
- Protective washers
- QuickCote+ neutralizes acid, prevents corrosion



Accessories & Fasteners

- Fasteners – zinc, tin, & lead plated
- Stainless steel & color-coded fasteners
- 800 amp solid copper booster clamps
- Adapters & conversions for all types of batteries – top post, side terminal & stud
- QuickHold battery hold-downs – adjustable, non-corroding, non-conducting



Tools

- HexCrimp & Diamond Crimp tool color-coded to match connectors & cable
- Brute hammer crimp – low cost
- Safe & dependable heat guns
- 9" and 22" cable cutters



- Instructions
- Safety
- Maintenance

QUICKCABLE®
Your Best Connection

3700 Quick Drive, Franksville, WI 53126-0509 U.S.A.
Phone 800-558-8667 Fax 800-733-8611
Email sales@quickcable.com

6395 Kestral Road, Mississauga, Ontario, L5T 1Z5 Canada
Phone 905-362-1606 Fax 905-362-1614
Email cdnsales@quickcable.com

Website <http://www.quickcable.com>



General Safety

1. Batteries produce hydrogen gas which could explode if there is a spark near the battery. Never work leaning over a battery. Do not have a flame near a battery. Do not smoke. Wear eye protection.
2. Batteries contain sulfuric acid which is corrosive and lead which is poisonous. Many battery connectors are made of lead or have a lead coating. Wash your hands thoroughly after installation. Do not allow children to play with batteries, battery cables or connectors.



Technical Information Upgrades

We are continually upgrading our tool line. For all current information visit our website: <http://www.quickcable.com>



Limited Warranty

Quick Cable Corporation manufactures the highest quality tools to exacting engineering standards. Quick Cable will replace any Quick® Crimper and HexCrimp Jr.® Crimper found to be defective and returned within two years of date of purchase. Quick Cable will replace any Cub Crimper found to be defective and returned within one year from date of purchase. Quick Cable will replace any Brute™ Hammer Crimp found to be defective & returned within six (6) months from the date of purchase. Quick Cable will replace any cutter found to be defective & returned within six months from date of purchase. This warranty replaces all other warranties. Replacement of defective products is your exclusive remedy. Quick Cable is not responsible for injury, property damage, or the consequential damages arising either directly or indirectly from the use of our products, even though that injury, property damage or other consequential damages may have been directly or indirectly caused by an actual defect in materials or workmanship. We like to know how our products have performed for you. We welcome your comments and suggestions regarding our products, their installation or performance. Contact us at: Quick Cable Corporation - 3700 Quick Drive, Franksville, WI 53126 U.S.A.

Cable Ga.	Die Settings	Do not use for crimping any heavy wall terminals, lugs or cable heavier than 1/0 gauge. See a safety sheet.
8	6	
6	10	
4	16	
2	25	
1	25	
1/0	30	

4245NHLB

Fig. 1 - Die setting chart

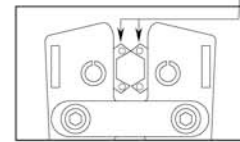


Fig. 2 - Push pin, rotate dies

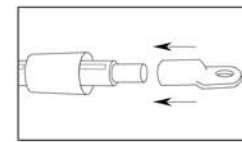


Fig. 3 - Slide heat shrink on first

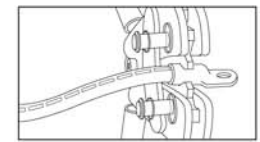


Fig. 4 - Position connector in dies

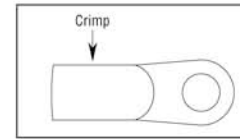


Fig. 5 - Crimp lug


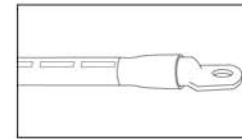


Fig. 6 - Shrink on tubing

1. Using the chart on the tool, determine the proper die setting for the gauge of cable and style of connector. Fig. 1
2. To select the dies, push the die pivot pins from the spring side and rotate both dies to the proper setting. Releasing the pivot pins locks the dies in place. Fig. 2
3. Strip cable insulation 3/4" for copper tube lugs so that the bare conductor seats fully in the connector. If you are using heat shrink tubing, slide it over the cable before applying the connector. Fig. 3
4. Open tool and position connector in crimp dies. Fully close dies for proper crimp. Fig. 4
5. Crimp a minimum of 1/8" in from the barrel end. Fig. 5
6. For best results, protect each termination with Quick Cable heat shrink tubing. Fig. 6

Maintenance

Quick Cable crimpers are factory lubricated with low friction, high temperature, synthetic lubricant. Additional lubrication may be required for very high usage tools. Simply add two or three drops of #30 weight oil to each pivot point. Circulate the oil by opening and closing the tool several times.

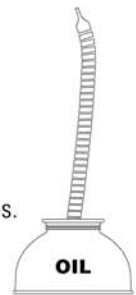

Replacement Parts

Dies, springs, snap rings and hardened hex pins are all available, just ask your distributor.